



SPECIFICATIONS

Range	: 0~500g
Tare	: Unlimited
Negative weight	: Tare Function will set negative weight to 0 without add-on.
Tare upon turning on	: Allow tare up to max tare upon turn on
Accuracy	: $\pm 1\%$ of reading
Calibration	: Four points of Automatic Calibration at 0g, 160g, 320g and 480g
Load Cell Technology	: 500g Compact Loadcell
Resolution	: 0.1g step
Minimum Weight	: >0.1g
Min. Add-on Wt.	: >0.1g
Power	: AC Adaptor: 9 V, 100mA (Supplied)

Battery:	9 V alkaline cell (Not supplied)
Warm-up time	: 3 seconds or less.
Display	: Four Digit LCD
Display after warm-up	: 0.0
Auto Off	: Auto off after 5 min. of no Load Change or Key Pressed.
Display Features	: Overload → "EE"
Low Power	: 7V ± 0.3V
Temperature	: Good performance within -10 degree Centigrade to +45 degree Centigrade.
Case & Platform	: Fine texture ABS plastic.


PHYSICAL FEATURES

Dimensions	: 20cm X 14.5cm X 5.5cm
Platform Size	: 11.5cm x 14cm, Fold up platform for weighing large letters
Weight	: 1lb 0.23oz (460g) without Batteries

KEYS

ON/TARE	: Scale ON and/or for setting the container weight to zero
OFF	: Scale OFF

KEYBOARD LAYOUT

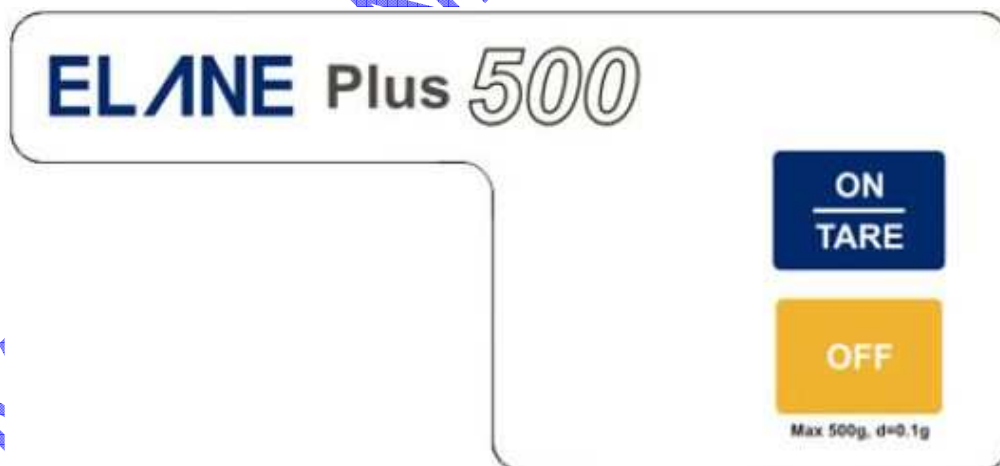

XIAN